

July 5th, 2022

Reference: Food Lion #2839
860 Parris Island Gtwy Beaufort, SC 29906
IP # 2021.1218

This letter is to inform the contractor of deficiencies which must be corrected as per Crescent Plumbing Survey. Refer to Crescent Survey and to the Construction Documents for additional information.

Deficiency D-14 CO3 Line – Fracture at 28'

Location: Inside / Sales
Description: Issue is located 108'6" right of right sales wall and 6' off rear sales wall; line is approximately 1'7" deep.
Response: CO3 line fracture should be repaired.

Deficiency D-15 CO5 Line - Blockage

Location: Outside / Front Store Right
Description: Blockage located on front right sidewalk, in cleanout riser.
Response: Remove blockage. Crescent to inspect line after blockage has been removed.

Deficiency D-16 Deli Cleanout Inaccessible

Location: Inside / Deli Bakery
Description: Issue deli/bakery cleanout inaccessible.
Response: Cleanout should be made accessible for full inspection.

Deficiency D-17 CO7 Line – Joint Offset at 126' and 128'.

Location: Inside / Deli Bakery Front
Description: Issue is located 49' off deli front wall and 19'3" left of deli right wall.
Response: Line pipes joint should be repaired.

Deficiency D-18 CO8 Line – Grease interceptor Outlet Cleanout

Location: Outside / Front Store Right
Description: CO8 lacking plug.
Response: Lacking plug prior to arrival. 6", install.